

2 May 2022

Ref: 171356/29725

Muswellbrook Coal Company PO Box 123 Muswellbrook NSW 2333

RE: APRIL 2022 NOISE MONITORING RESULTS - MUSWELLBROOK COAL MINE

This letter report presents the results of noise compliance monitoring, commencing at about 10.00 pm on Tuesday 26th of April, 2022, for the Muswellbrook Coal Company (MCC) mine at Muscle Creek Road, Muswellbrook. The monitoring was undertaken as per the requirements of D.A. 205/2002 and detailed in the Noise Management Plan (NMP) for the mine.

Attended Noise Monitoring Program

Noise monitoring was undertaken in accordance with the NMP as summarised below.

All attended monitoring and equipment maintenance and calibration is conducted in accordance with the Noise Policy for Industry (NPI) and AS1055 – Acoustics, Description and Measurement of Environmental Noise.

Attended noise monitoring is undertaken monthly by an independent noise consultant. Each attended noise survey will be conducted during night periods only. If it is identified during the noise monitoring that the mining noise from the operation is exceeding the criteria, MCC will be notified and the operations will be modified as required. Monitoring at the location(s) where the noise levels are elevated will be undertaken again with a minimum break of 75 minutes between monitoring.

The noise criteria for MCC apply under all meteorological conditions except for the following:

- i. Wind speeds greater than 3m/s at 10m above ground level; or
- ii. Stability category F temperature inversion conditions and wind speeds greater than 2 m/s at 10m above ground level; or
- iii. Stability category G temperature inversion conditions.

To determine compliance with the Leq (15 min) operational noise criteria the modification factors detailed in Section 4 of the NPI must be applied, as appropriate, to the measured noise levels.

Due to the distance of the mine from each residence, the monitoring of LA1 (1minute) at the facade is not considered necessary and will be conducted at/or near the property boundary.

Phone: 0412 023 455



The attended noise monitoring locations are detailed in Table 1 and shown in Figure 1.

Table 1 Noise Monitoring Locations						
Location Description						
R13	Sandy Creek Road					
R15	Queen St					
R17	Queen St					
R25 Sandy Creek Road						
R32 Muscle Creek Road						

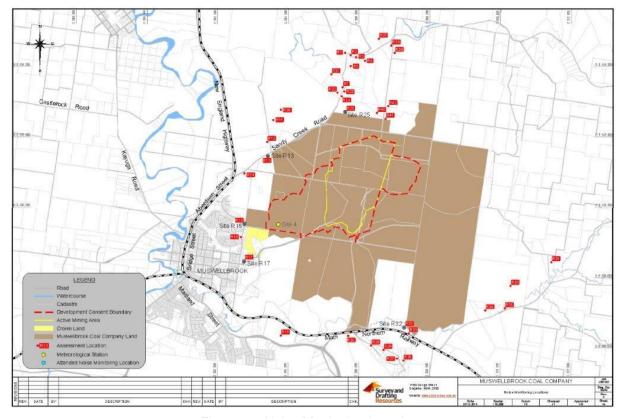


Figure 1 – Noise Monitoring Locations

Noise criteria for all assessment locations shown in Figure 1 are detailed in Appendix I to this report.

Monitoring Equipment

Attended noise monitoring was conducted with a Brüel & Kjær Type 2250 Precision Sound Analyser. This instrument has Type 1 characteristics as defined in AS1259-1990 "Sound Level Meters" and has current NATA calibration. Field calibration is carried out at the start and end of each monitoring period. Calibration certificates are attached as **Appendix II** to this report.

A-weighted noise levels were measured over the 15 minute monitoring period with data acquired of 1 second statistical intervals and the meter set to "fast" response. Each 1 second measurement is accompanied by a third-octave band spectrum from 20 - 20k Hz which is required for analysing NPI 'modifying factors'.





Time based field notes allow for determination of the relative contributions to the overall noise level of all significant noise sources.

Measurement Analysis

The MCC compliance noise criteria are based on a 15 minute Leq noise level. The 15 minute Leq noise level for each monitoring period is shown in the tables below. Where the noise from MCC was audible Bruel & Kjaer "Evaluator" analysis software was used to quantify the contribution of the mine and other significant noise sources to the overall level. Mine noise from MCC is shown in the table in bold type.

All noise levels shown are in dB(A) Leq (15 min) unless otherwise detailed.

MCC Operations

Operational details for MCC for the monitoring period on 26th of April, 2022 are shown in **Appendix III**.

Noise Compliance Assessment

The results of the noise measurements are shown in **Table 2**.

	Table 2									
		dB(A),	MCC	Criterion	dB(A),	Criterion	Its – 26 April Stability	Compliant		
Location	Time	Leq	Contribution dB(A), Leq	dB(A) Leq	L1 (1min)¹	dB(A), L1 (1min) ¹	Class/ Wind speed (m/s)/dir ^o	Met Conditions?	Identified Noise Sources ²	
R13 Sandy Creek Rd.	10:18 pm	38	38	41	42	45	D/3.3/116	No	MCC (38), insects (28)	
R15 Queen St.	10:56 pm	34	34	37	40	45	D/2.8/157	Yes	MCC (34), insects (21)	
R17 Queen St.	11:13 pm	39	34	35	38	45	D/2.6/181	Yes	Insects (37), MCC (34)	
R25 Sandy Creek Rd.	10:00 pm	35	35	42	40	45	D/2.9/119	Yes	MCC (35), insects (23)	
R32 Muscle Creek Rd.	11:35 pm	36	n/a	35	n/a	45	D/2.7/136	Yes	Frogs & insects (36), MCC inaudible	

- 1. L1 (1 min) from MCC mine noise only
- 2. See text regarding MCC noise sources

The results in Table 2 show that, under the operational and meteorological conditions at the time, noise from MCC did not exceed the relevant noise criteria at any time or location during the monitoring period.

The data from the mine operated weather station showed that meteorological conditions were compliant with the conditions in the NMP for the entire noise monitoring survey, with the exception of R13. The



measurement at this location commenced at 10.18pm. In the 15 minutes to 10.30pm the wind speed was 3.3m/s, which is marginally higher than the 3m/s compliance level. Conditions at ground level were relatively calm with no noticeable wind or rustling of leaves in trees etc. A wind at 3.3m/s from the direction 116° would be noise enhancing at the monitoring location at R13.

Mine noise from Muswellbrook Coal was consistently audible and measurable at monitoring locations R13, R15, R17 and R25.

At each of these locations the mine noise was attributable to engine revs, dumping noise and occasional modulated frequency reverse alarms.

Data from those times where MCC operations were consistently audible were analysed using the "Evaluator" software. This analysis showed the noise did not contain any tonal or impulsive components as per definitions in the Noise Policy for Industry (NPfl).

The methodology for analysing the low frequency noise modifying factor correction in the NPfl is shown in extract below.

Low-frequency noise	Measurement of source contribution C-weighted and A-weighted level and one-third octave measurements in the range 10–160 Hz	Measure/assess source contribution C- and A-weighted Leq,T levels over same time period. Correction to be applied where the C minus A level is 15 dB or more and: • where any of the one-third octave noise levels in Table C2 are exceeded by up to and including 5 dB and cannot be mitigated, a 2- dB(A) positive adjustment to measured/predicted A- weighted levels applies for the evening/night period • where any of the one-third octave noise levels in Table C2 are exceeded by more than 5 dB and cannot be mitigated, a 5-dB(A) positive adjustment to measured/predicted A- weighted levels applies for the evening/night period and a 2- dB(A) positive adjustment applies for the daytime period.	2 or 5 dB ²	A difference of 15 dB or more between C- and A-weighted measurements identifies the potential for an unbalance spectrum and potential increased annoyance. The values in Table C2 are derived from Moorhouse (2011) for DEFRA fluctuating low-frequency noise criteria with corrections to reflect external assessment locations.
------------------------	---	--	------------------------	---

Table C2: One-third octave low-frequency noise thresholds.

Hz/dB(Z) One-third octave dB(Z) Leq (15 min) threshold level													
Frequency (Hz)	10	12.5	16	20	25	31.5	40	50	63	80	100	125	160
dB(Z)	92	89 86 77 69 61 54 50 50 48 48 46 44											

Doc. No: 171356-29725

May 2022



The correction applies to the mine noise component only. There are, typically, many sources of low frequency noise in the acoustic environment of each receiver area (including noise from distant road and rail traffic).

In many cases the C minus A level is greater than 15dB due to these other noise sources. In most instances the screening criteria will be the one third octave analysis. Should the mine noise not comply with this then the C minus A analysis will be applied.

Tables 3 to **6** show the low frequency noise analysis for the periods where the mine noise was able to be accurately isolated from the overall measurements during the monitoring at Locations R13, R15, R17 and R25.

	Table 3												
	Low Frequency Noise Analysis – 26 April 2022												
Frequency (Hz)	10	12.5	16	20	25	31.5	40	50	63	80	100	125	160
R13 Sandy Ck Rd.	R13 Sandy Ck Rd. <33 33.8 36.5 44.1 40.9 41.2 42.1 46.2 44.9 44.9 43.3 41.2 35.0												
dB(Z) Criterion 92 89 86 77 69 61 54 50 50 48 48 46 44													
Exceedance	0	0	0	0	0	0	0	0	0	0	0	0	0

	Table 4												
			Low F	requenc	y Noise	Analys	is – 26 <i>i</i>	April 20	22				
Frequency (Hz)	10	12.5	16	20	25	31.5	40	50	63	80	100	125	160
R15 Queen St.	<25	25.5	32.7	33.0	32.1	33.5	39.7	44.5	37.6	37.8	35.8	36.8	30.3
dB(Z) Criterion	92	89	86	77	69	61	54	50	50	48	48	46	44
Exceedance	0	0	0	0	0	0	0	0	0	0	0	0	0

	Table 5												
Low Frequency Noise Analysis – 26 April 2022													
Frequency (Hz)	10	12.5	16	20	25	31.5	40	50	63	80	100	125	160
R17 Queen St.	R17 Queen St. <43 43.9 45.2 43.8 42.3 42.7 43.0 45.8 42.3 43.6 41.7 42.6 35.0												
dB(Z) Criterion	92	89	86	77	69	61	54	50	50	48	48	46	44
Exceedance	0	0	0	0	0	0	0	0	0	0	0	0	0

	Table 6												
	Low Frequency Noise Analysis – 26 April 2022												
Frequency (Hz)	10	12.5	16	20	25	31.5	40	50	63	80	100	125	160
R25 Sandy Ck Rd.	R25 Sandy Ck Rd. <29 29.5 31.5 37.5 37.4 37.8 43.9 40.0 39.3 41.2 39.7 40.2 38.1									38.1			
dB(Z) Criterion	dB(Z) Criterion 92 89 86 77 69 61 54 50 50 48 48 46 44												
Exceedance	0	0	0	0	0	0	0	0	0	0	0	0	0

The results in Tables 3 to 6 show that there is no requirement to apply a low frequency noise modifying factor correction to the measured mine noise level at Locations R15, R15, R17 and R25.

In addition to the operational noise, the noise from MCC must not exceed 45 or 47 dB(A) L1 (1 min) between the hours of 10 pm and 7 am (see Appendix I for details of noise criteria at various receiver



locations). This is to minimise the potential for sleep disturbance as a result of individual loud noises from the mine. The compliance measurement locations are different for each of the operational and sleep disturbance noise. That is, the sleep disturbance criterion is typically applicable at 1m from the facade of a bedroom window.

To avoid undue disturbance to residents the L1 (1 min) noise level from the operational measurements are used to show general compliance with the sleep disturbance criterion. That is, as the distance between the noise source and the operational noise monitoring location is significantly greater than the distance between the operational noise monitoring location and the sleep disturbance monitoring location (i.e. 1m from the facade of the house) there will be little variation in L1 (1 min) levels between the two monitoring locations.

It must be noted, however, that the sleep disturbance criterion is applicable at the outside of a bedroom window. As the internal layout of each residence is not known, to consider a worst case, the bedroom windows were assumed to be facing towards the mine.

As shown in Table 2, during the night time measurement circuit the L1 (1 min) noise from MCC did not exceed 45 dB(A) at any monitoring location.

At each of locations R13, R15, R17 and R25 the L1 (1 min) noise was attributable to engine revs.

We trust this report fulfils your requirements at this time, however, should you require additional information or assistance please contact the undersigned on 0412 023 455.

Yours faithfully,

SPECTRUM ACOUSTICS PTY LIMITED

Author:

Review:

Ross Hodge

Acoustical Consultant

Neil Pennington
Acoustical Consultant

Doc. No: 171356-29725

May 2022



Appendix I

Noise criteria from Development Consent DA205/2002 (Locations as per Figure 1).

Location	Day	Evening	Nig	ht
Location	L _{Aeq(15 minute)}	L _{Aeq(15 minute)}	L _{Aeq(15 minute)}	L _{A1 (1 minute)}
R1, R2, R3, R4, R17, R26, R27, R28, R29, R30, R31, R32, R33, R34, R35, R37, R38, R39	35	35	35	45
R5	36	36	36	45
R7	38	38	38	45
R11	39	39	39	45
R12	39	39	39	45
R13	41	41	41	45
R14	38	38	38	45
R15	37	37	37	45
R16	36	36	36	45
R17	35	35	35	45
R18	45	38	37	47
R20	45	38	37	47
R21	37	37	37	45
R22	39	39	39	45
R23	39	39	39	45
R24	40	40	40	45
R25	42	42	42	45
R36	38	38	38	45
R40	42	42	42	45
R41	42	42	42	45
R42	40	40	40	45

Note: All levels are in dB(A)

Note: Following further consultation with the community it has been identified that R11 is a stable complex, not a residence, so the criteria listed in the table above do not apply.

Doc. No: 171356-29725 May 2022



Appendix II

Calibration Certificates



NATA WORLD RECOGNISED

Australian Calibration Laboratory
Suite 4.03, Level 4, 3 Thomas Holt Drive, Macquarie Park NSW 2113, Australia
Accredited for compliance with ISO/IEC 17025 - Calibration. Laboratory No. 1301

CERTIFICATE OF CALIBRATION

Certificate No: CAU2100868

Page 1 of 11

CALIBRATION OF:

2250 No: 2747794 Sound Level Meter: Bruel & Kjaer 4189 No: 2733511 Bruel & Kiaer Microphone: ZC-0032 No: 15339 Preamplifier: Bruel & Kiaer Supplied Calibrator: Bruel & Kjaer 4231 No: 2466354 Software version: BZ7224 Version 4.6 Pattern Approval: PTB Instruction manual: BE1712-22 Identification: N/A

CUSTOMER:

Spectrum Acoustics Pty Ltd Suite 1, 12 Alma Road New Lambton NSW 2305

CALIBRATION CONDITIONS:

Preconditioning: 4 hours at 23 °C

Environment conditions: see actual values in Environmental conditions sections

SPECIFICATIONS:

The Sound Level Meter has been calibrated in accordance with the requirements as specified in IEC61672-1:2013 class 1. Procedures from IEC 61672-3:2013 were used to perform the periodic tests.

 $\label{thm:continuity} The \ measurements \ included \ in \ this \ document \ are \ traceable \ to \ Australian/National \ standards.$

PROCEDURE:

The measurements have been performed with the assistance of Brüel & Kjær Sound Level Meter Calibration System B&K 3630 with application software type 7763 (version 8.3 - DB: 8.30) and test procedure 2250-4189.

RESULTS:

	Initial calibration	Calibration prior to repair/adjustment
Х	Calibration without repair/adjustment	Calibration after repair/adjustment

The reported expanded uncertainty is based on the standard uncertainty multiplied by a coverage factor k = 2 providing a level of confidence of approximately 95 %. The uncertainty evaluation has been carried out in accordance with EA-4/02 from elements originating from the standards, calibration method, effect of environmental conditions and any short time contribution from the device under calibration.

Date of Calibration: 06/12/2021

Certificate issued: 06/12/2021

Sajeeb Tharayil
Calibration Technician

Craig Patrick

Approved signator

Reproduction of the complete certificate is allowed. Part of the certificate may only be reproduced after written permission.





ACOUSTIC Unit 36/14 Loyalty Rd
North Rocks NSW AUSTRALIA 2151
Ph: +61 2 9484 0800 A.B.N. 65 160 399 119

Labs Pty Ltd | www.acousticresearch.com.au

Sound Calibrator IEC 60942-2017

Calibration Certificate

Calibration Number C21052

Client Details Spectrum Acoustics

30 Veronica Street Cardiff NSW 2285

Equipment Tested/ Model Number: Pulsar Model 105

Instrument Serial Number: 75503

Atmospheric Conditions

Ambient Temperature : 23.8°C Relative Humidity : 48.3% Barometric Pressure : 100.16kPa

Calibration Technician: Jeff Yu Secondary Check: Max Moore Calibration Date: 04 Feb 2021 Report Issue Date: 5 Feb 2021

Approved Signatory :

Ken Williams

Characteristic Tested	Result	
Generated Sound Pressure Level	Pass	
Frequency Generated	Pass	
Total Distortion	Pass	

2	Nominal Level	Nominal Frequency	Measured Level	Measured Frequency
	94	1000	94.00	1000.30

The sound calibrator has been shown to conform to the class 1 requirements for periodic testing, described in Annex B of IEC 60942 2017 for the sound pressure level(s) and frequency(ies) stated, for the environmental conditions under which the tests were performed.

Specific Tests

Least Uncertainties of Measurement -Environmental Conditions

All uncertainties are derived at the 95% confidence level with a coverage factor of 2.

NATA

This calibration certificate is to be read in conjunction with the calibration test report.

Acoustic Research Labs Pty Ltd is NATA Accredited Laboratory Number 14172. Accredited for compliance with ISO/IEC 17025 - calibration.

The results of the tests, calibrations and/or measurements included in this document are traceable to SI units.

NATA is a signatory to the ILAC Mutual Recognition Atrangement for the mutual recognition of the equivalence of testing, medical testing, calibration and inspection reports.

PAGE 1 OF 1



^{*} The tests <1000 kHz are not covered by Acoustic Research Labs Pty Ltd NATA accreditation.</p>



Appendix III

Operational Details - 26 April 2022 (10.00pm to midnight)

For that period mining was carried out as follows;

- 211, 4 x Hitachi 3500 trucks in Out of Pit dump hauling waste to the RL245 dump in Pit 1
- 1 x D10 assisting in Out of Pit Dump
- 1 x D10 dozer on RL245 dump in Pit 1.
- No crushing
- Washing plant running with 1 x CAT 777
- 323 Loader pushing in SP1
- 1 x watercart
- 1 x grader
- Drilling in S25

