

7 February 2024

Ref: 212218/10217

Muswellbrook Coal Company PO Box 123 Muswellbrook NSW 2333

RE: JANUARY 2024 NOISE MONITORING RESULTS - MUSWELLBROOK COAL MINE

This letter report presents the results of noise compliance monitoring, commencing at about 10:00 pm on Tuesday 16th of January, 2024, for the Muswellbrook Coal Company (MCC) mine at Muscle Creek Road, Muswellbrook. The monitoring was undertaken as per the requirements of D.A. 205/2002 and detailed in the Noise Management Plan (NMP) for the mine.

Attended Noise Monitoring Program

Noise monitoring was undertaken in accordance with the NMP as summarised below.

All attended monitoring and equipment maintenance and calibration is conducted in accordance with the Noise Policy for Industry (NPfI) and AS1055 – Acoustics, Description and Measurement of Environmental Noise.

Attended noise monitoring is undertaken monthly by an independent noise consultant. Each attended noise survey will be conducted during night periods only. If it is identified during the noise monitoring that the mining noise from the operation is exceeding the criteria, MCC will be notified and the operations will be modified as required. Monitoring at the location(s) where the noise levels are elevated will be undertaken again with a minimum break of 75 minutes between monitoring.

The noise criteria for MCC apply under all meteorological conditions except for the following:

- i. Wind speeds greater than 3m/s at 10m above ground level; or
- ii. Stability category F temperature inversion conditions and wind speeds greater than 2 m/s at 10m above ground level; or
- iii. Stability category G temperature inversion conditions.

To determine compliance with the Leq (15 min) operational noise criteria the modification factors detailed in Section 4 of the NPI must be applied, as appropriate, to the measured noise levels.

Due to the distance of the mine from each residence, the monitoring of LA1 (1minute) at the facade is not considered necessary and will be conducted at/or near the property boundary.



Noi	Table 1 Noise Monitoring Locations						
Location Description							
R13	Sandy Creek Road						
R15	Queen St						
R17	Queen St						
R25	Sandy Creek Road						
R32	Muscle Creek Road						

The attended noise monitoring locations are detailed in Table 1 and shown in Figure 1.

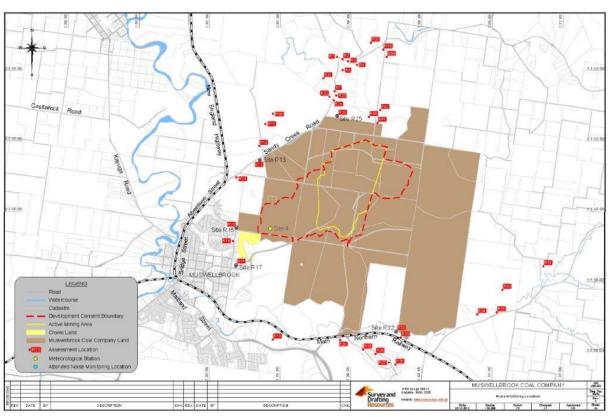


Figure 1 – Noise Monitoring Locations

Noise criteria for all assessment locations shown in Figure 1 are detailed in Appendix I to this report.

Monitoring Equipment

Attended noise monitoring was conducted with a Brüel & Kjær Type 2250 Precision Sound Analyser. This instrument has Type 1 characteristics as defined in AS1259-1990 "Sound Level Meters" and has current NATA calibration. Field calibration is carried out at the start and end of each monitoring period. Calibration certificates are attached as **Appendix II** to this report.

A-weighted noise levels were measured over the 15 minute monitoring period with data acquired of 1 second statistical intervals and the meter set to "fast" response. Each 1 second measurement is accompanied by a third-octave band spectrum from 20 - 20k Hz which is required for analysing NPI 'modifying factors'.





Time based field notes allow for determination of the relative contributions to the overall noise level of all significant noise sources.

Measurement Analysis

The MCC compliance noise criteria are based on a 15 minute Leq noise level. The 15 minute Leq noise level for each monitoring period is shown in the tables below. Where the noise from MCC was audible Bruel & Kjaer "*Evaluator*" analysis software was used to quantify the contribution of the mine and other significant noise sources to the overall level. Mine noise from MCC is shown in the table in bold type.

All noise levels shown are in dB(A) Leq (15 min) unless otherwise detailed.

MCC Operations

Operational details for MCC for the monitoring period on the 16th of January, 2024 are detailed in **Appendix III**. At the time of the noise monitoring MCC had ceased mining operations and work was being undertaken to rehabilitate the site.

Noise Compliance Assessment

The results of the noise measurements are shown in Table 2.

					Table	e 2			
			MCC Oper	rational Nois	se Monitor	ing Results	– 16 January	2024	1
Location	Time	dB(A), Leq	MCC Contribution dB(A), Leq	Criterion dB(A) Leq	dB(A), L1 (1min) ¹	Criterion dB(A), L1 (1min) ¹	Stability Class/ Wind speed (m/s)/dir ^o	Compliant Met Conditions?	Identified Noise Sources ²
R13 Sandy Creek Rd.	10:31pm	37	33	41	42	45	F/2.1/144	No	MCC (33), frogs (33), insects (30)
R15 Queen St.	11:01pm	36	26	37	29	45	F/1.9/146	Yes	Insects (34), frogs (29), MCC (26)
R17 Queen St.	11:25pm	52	n/a	35	n/a	45	E/1.8/135	Yes	Traffic (52), insects (41), frogs (33), MCC inaudible
R25 Sandy Creek Rd.	10:08pm	40	32	42	36	45	D/2.7/128	Yes	Insects (39), MCC (32) , dog (29)
R32 Muscle Creek Rd.	11:57pm	53	n/a	35	n/a	45	F/2.1/163	No	Traffic (53), insects (32), train (29), MCC inaudible

1. L1 (1 min) from MCC mine noise only

2. See text regarding MCC noise sources

The results in Table 2 show that, under the operational and meteorological conditions at the time, noise from MCC was inaudible at monitoring locations R17 and R32.



Table 2 also shows that the noise was consistent enough to be measurable at monitoring locations R13, R15, and R25. At these locations the noise from MCC was from a combination of mine hum with occasional engine revs, and dozer tracks.

The data analysis presented in Table 2 shows that the noise from MCC did not exceed the relevant noise criteria at any time or location during the monitoring period.

The data from the mine operated weather station showed that meteorological conditions were compliant with the conditions in the NMP for the entire noise monitoring survey, except for at locations R13 and R32.

As indicated above, noise from MCC was measurable at monitoring locations R13, R15 and R25.

Data from those times where MCC operations were audible during the monitoring survey were analysed using the *"Evaluator"* software. This analysis showed the noise did not contain any tonal or impulsive components as per definitions in the NPI.

The methodology for analysing the low frequency noise modifying factor correction in the NPI is shown in extract below.

Low-frequency noise	Measurement of source contribution C- weighted and A- weighted level and one-third octave measurements in the range 10– 160 Hz	 Measure/assess source contribution C- and A-weighted Leq,T levels over same time period. Correction to be applied where the C minus A level is 15 dB or more and: where any of the one-third octave noise levels in Table C2 are exceeded by up to and including 5 dB and cannot be mitigated, a 2- dB(A) positive adjustment to measured/predicted A- weighted levels applies for the evening/night period where any of the one-third octave noise levels in Table C2 are exceeded by more than 5 dB and cannot be mitigated, a 5- dB(A) positive adjustment to measured/predicted A- weighted levels applies for the evening/night period and a 2- dB(A) positive adjustment applies for the daytime period. 	2 or 5 dB ²	A difference of 15 dB or more between C- and A-weighted measurements identifies the potential for an unbalance spectrum and potential increased annoyance. The values in Table C2 are derived from Moorhouse (2011) for DEFRA fluctuating low- frequency noise criteria with corrections to reflect external assessment locations.
------------------------	---	--	------------------------	---

Table C2 : One-third octave low-frequency noise thresholds.

Hz/dB(Z)	One-th	nird octa	ave dB(2	Z) Leq (15 min)	thresho	ld level						
Frequency (Hz)	10	12.5	16	20	25	31.5	40	50	63	80	100	125	160
dB(Z)	92	89	86	77	69	61	54	50	50	48	48	46	44

The correction applies to the mine noise component only. There are many sources of low frequency noise in the acoustic environment of each receiver area (including noise from road and rail traffic). In many cases the C minus A level is greater than 15 due to these other noise sources. In most instances the screening criteria will be the one third octave analysis. The NPI quantitative assessment of noise from MCC can only be conducted where the noise was clearly definable, which is at a level typically greater than 30 dB(A) or when there are no other significant sources.

Table 3 presents the low-frequency assessment of the mine noise measured at 32 dB(A) at Location R25 on the 16^{th} January 2024.

		Table 3.	Low-fr	equenc	y analys	sis – R2	5 Sandy	Creek	Rd 10:0	8 pm			
Hz/dB(Z)	One-th	nird octa	ave LZe	q,15mir	thresh	nold leve	el						
Frequency (Hz)	10	12.5	16	20	25	31.5	40	50	63	80	100	125	160
R25, dB(Z)		40	38	35	37	35	35	34	38	39	39	36	30
Threshold, dB(Z)	92	89	86	77	69	61	54	50	50	48	48	46	44
Exceedance, dB		0	0	0	0	0	0	0	0	0	0	0	0

Table 4 presents the low-frequency assessment of the mine noise measured at 33 dB(A) at Location R13 on the 16^{th} January 2024.

		Table 4	Low-fr	equenc	y analys	sis – R1	3 Sandy	Creek	Rd 10:3	1 pm			
Hz/dB(Z)	One-th	hird octa	ave LZe	q,15mir	thresh	nold leve	el						
Frequency (Hz)	10	12.5	16	20	25	31.5	40	50	63	80	100	125	160
R13, dB(Z)		43	42	41	42	38	39	37	39	39	37	33	32
Threshold, dB(Z)	92	89	86	77	69	61	54	50	50	48	48	46	44
Exceedance, dB		0	0	0	0	0	0	0	0	0	0	0	0

The results in Tables 3 to 4 show no exceedance of the low-frequency criteria.

In addition to the operational noise, the noise from MCC must not exceed **45 or 47 dB(A) L1 (1 min)** between the hours of 10 pm and 7 am (see Appendix I for details of noise criteria at various receiver locations). This is to minimise the potential for sleep disturbance as a result of individual loud noises from the mine.

The compliance measurement locations are different for each of the operational and sleep disturbance noise. That is, the sleep disturbance criterion is typically applicable at 1m from the facade of a bedroom window.

To avoid undue disturbance to residents the L1 (1 min) noise level from the operational measurements are used to show general compliance with the sleep disturbance criterion. That is, as the distance between the noise source and the operational noise monitoring location is significantly greater than the distance between the operational noise monitoring location and the sleep disturbance monitoring





location (i.e. 1m from the facade of the house) there will be little variation in L1 (1 min) levels between the two monitoring locations.

It must be noted, however, that the sleep disturbance criterion is applicable at the outside of a bedroom window. As the internal layout of each residence is not known, to consider a worst case, the bedroom windows were assumed to be facing towards the mine.

As shown in Table 2, during the night time measurement circuit the L1 (1 min) noise from MCC did not exceed 45 dB(A) at any monitoring location.

We trust this report fulfils your requirements at this time, however, should you require additional information or assistance please contact the undersigned on (02) 4954 2276.

Yours faithfully,

SPECTRUM ACOUSTICS PTY LIMITED

Author:

Neil Pennington Acoustical Consultant

Appendix I

Noise criteria from Development Consent DA205/2002 (Locations as per Figure 1).

Location	Day	Evening	Nig	ht
Location	L _{Aeq(15 minute)}	L _{Aeq(15 minute)}	L _{Aeq(15 minute)}	L _{A1 (1 minute)}
R1, R2, R3, R4, R17, R26, R27, R28, R29, R30, R31, R32, R33, R34, R35, R37, R38, R39	35	35	35	45
R5	36	36	36	45
R7	38	38	38	45
R11	39	39	39	45
R12	39	39	39	45
R13	41	41	41	45
R14	38	38	38	45
R15	37	37	37	45
R16	36	36	36	45
R17	35	35	35	45
R18	45	38	37	47
R20	45	38	37	47
R21	37	37	37	45
R22	39	39	39	45
R23	39	39	39	45
R24	40	40	40	45
R25	42	42	42	45
R36	38	38	38	45
R40	42	42	42	45
R41	42	42	42	45
R42	40	40	40	45

Note: All levels are in dB(A)

Note: Following further consultation with the community it has been identified that R11 is a stable complex, not a residence, so the criteria listed in the table above do not apply.



Appendix II

Calibration Certificates

NVMS				NATA
	rive, Macquarie Park NSW 2113, Australi			
	IEC 17025 - Calibration. Laboratory No. 1		638 5	Page 1 of 11
CERTIFICATE OF	CALIBRATION	Certificate No: CAU2300	038 F	age 100 11
CALIBRATION OF:	and the second	and the second second		
Sound Level Meter:	Brüel & Kjær	2250	No: 2653961	
Microphone:	Brüel & Kjær	4966	No: 3343809	
Preamplifier:	Brüel & Kjær	ZC-0032	No: 25104	
Supplied Calibrator:	None			
Software version:	BZ7224 Version 4.7.6	Pattern Approval:	10 C	
nstruction manual:	BE1897-11	Identification:	N/A	
USTOMER:	Datas - 1			
	Spectrum Acoustics Pty Ltd			
	8 Panylan St			
	Cardiff NSW 2285			
	Miggl			Contraction of the second
	TIONS			
CALIBRATION CONDI	HUNS:			
	4 hours at 23 °C			
Preconditioning: Environment conditions: PECIFICATIONS:	4 hours at 23 °C see actual values in Environ		ed in IEC61672-1:201	3 class 1.
Preconditioning: Environment conditions: SPECIFICATIONS: The Sound Level Meter has l Procedures from IEC 61672-	4 hours at 23 °C see actual values in Environ been calibrated in accordance 3:2013 were used to perform t	with the requirements as specific		3 class 1.
Preconditioning: Environment conditions: PECIFICATIONS: The Sound Level Meter has l Procedures from IEC 61672- The measurements included PROCEDURE: The measurements have been 1630 with application softwo	4 hours at 23 °C see actual values in Environ been calibrated in accordance 3:2013 were used to perform i i in this document are traceable en performed with the assistant	with the requirements as specific the periodic tests.	ds. Meter Calibration Sys	ut-parti
Preconditioning: Environment conditions: SPECIFICATIONS: The Sound Level Meter has I Procedures from IEC 61672- The measurements included PROCEDURE: The measurements have bee 3630 with application softwo	4 hours at 23 °C see actual values in Environ been calibrated in accordance 3:2013 were used to perform i i in this document are traceable en performed with the assistant	with the requirements as specific the periodic tests. le to Australian/National standard nce of Brüel & Kjær Sound Level M	ds. Meter Calibration Sys 49 <mark>6</mark> 6.	ut-parti
Preconditioning: Environment conditions: SPECIFICATIONS: The Sound Level Meter has I Procedures from IEC 61672- The measurements included PROCEDURE: The measurements have bee 3630 with application softw. RESULTS:	4 hours at 23 °C see actual values in Environ been calibrated in accordance 3:2013 were used to perform i d in this document are traceabl en performed with the assistant are type 7763 (version 8.6 - DE	with the requirements as specific the periodic tests. le to Australian/National standard nce of Brüel & Kjær Sound Level N 3: 8.60) and test procedure 2250-	ds. Meter Calibration Sys 4966. Yadjustment	ut-parti
Procedures from IEC 61672- The measurements included PROCEDURE: The measurements have be 3630 with application softw. RESULTS: Initial calibration Calibration without The reported expanded unc a level of confidence of app	4 hours at 23 °C see actual values in Environ been calibrated in accordance 3:2013 were used to perform i d in this document are traceable en performed with the assistant are type 7763 (version 8.6 - DE repair/adjustment ertainty is based on the standar roximately 95 %. The uncertain rom the standards, calibration	with the requirements as specific the periodic tests. le to Australian/National standard nce of Brüel & Kjær Sound Level N 3: 8.60) and test procedure 2250- Calibration prior to repair/	ds. Meter Calibration Sys 4966. Yadjustment justment verage factor k = 2 p ut in accordance with	roviding
Preconditioning: Environment conditions: SPECIFICATIONS: The Sound Level Meter has I Procedures from IEC 61672- The measurements included PROCEDURE: The measurements have been 3630 with application softworks RESULTS: Initial calibration Calibration without The reported expanded unco a level of confidence of appli- from elements originating fr	4 hours at 23 °C see actual values in Environ been calibrated in accordance 3:2013 were used to perform if in this document are traceabl en performed with the assistant are type 7763 (version 8.6 - DE repair/adjustment ertainty is based on the standar roximately 95 %. The uncertain rom the standards, calibration e under calibration.	with the requirements as specific the periodic tests. le to Australian/National standard nce of Brüel & Kjær Sound Level M 8: 8:60) and test procedure 2250- Calibration prior to repair/ X Calibration after repair/ad ard uncertainty multiplied by a co by evaluation has been carried of	ds. Meter Calibration Sys 4966. Yadjustment justment verage factor k = 2 p ut in accordance with conditions and any s	roviding
Preconditioning: Environment conditions: PECIFICATIONS: The Sound Level Meter has l procedures from IEC 61672- The measurements included PROCEDURE: The measurements have been 1630 with application softw. RESULTS: Initial calibration Calibration without The reported expanded unco- Level of confidence of appli- rom elements originating from the deviced	4 hours at 23 °C see actual values in Environ been calibrated in accordance 3:2013 were used to perform if in this document are traceabl en performed with the assistant are type 7763 (version 8.6 - DE repair/adjustment ertainty is based on the standar roximately 95 %. The uncertain rom the standards, calibration e under calibration.	with the requirements as specific the periodic tests. le to Australian/National standard nce of Brüel & Kjær Sound Level M 8: 8:60) and test procedure 2250- Calibration prior to repair/ X Calibration after repair/ad ard uncertainty multiplied by a co ty evaluation has been carried on method, effect of environmental	ds. Meter Calibration Sys 4966. Yadjustment justment verage factor k = 2 p ut in accordance with conditions and any s	roviding
Preconditioning: Environment conditions: PECIFICATIONS: the Sound Level Meter has livrocedures from IEC 61672- the measurements included PROCEDURE: the measurements have bere 630 with application softw. RESULTS: Initial calibration Calibration without the reported expanded unco- level of confidence of appro- rom elements originating frontribution from the device	4 hours at 23 °C see actual values in Environ been calibrated in accordance 3:2013 were used to perform if in this document are traceabl en performed with the assistant are type 7763 (version 8.6 - DE repair/adjustment ertainty is based on the standar roximately 95 %. The uncertain rom the standards, calibration e under calibration.	with the requirements as specific the periodic tests. le to Australian/National standard nce of Brüel & Kjær Sound Level M 8: 8:60) and test procedure 2250- Calibration prior to repair/ X Calibration after repair/ad ard uncertainty multiplied by a co ty evaluation has been carried on method, effect of environmental	ds. Meter Calibration Sys 4966. Yadjustment justment verage factor k = 2 p ut in accordance with conditions and any s	roviding
Preconditioning: Environment conditions: PECIFICATIONS: The Sound Level Meter has l procedures from IEC 61672- The measurements included PROCEDURE: The measurements have been 1630 with application softw. RESULTS: Initial calibration Calibration without The reported expanded unco- Level of confidence of appli- rom elements originating from the deviced	4 hours at 23 °C see actual values in Environ been calibrated in accordance 3:2013 were used to perform in this document are traceable en performed with the assistant are type 7763 (version 8.6 - DE repair/adjustment ertainty is based on the standar roximately 95 %. The uncertain rom the standards, calibration e under calibration. n: 12/09/2023	with the requirements as specific the periodic tests. le to Australian/National standard nce of Brüel & Kjær Sound Level M 8: 8:60) and test procedure 2250- Calibration prior to repair/ X Calibration after repair/ad ard uncertainty multiplied by a co ty evaluation has been carried on method, effect of environmental	ds. Meter Calibration Sys 4966. Yadjustment justment verage factor k = 2 p ut in accordance with conditions and any s	roviding
Preconditioning: Environment conditions: SPECIFICATIONS: The Sound Level Meter has 1 Procedures from IEC 61672- The measurements included PROCEDURE: The measurements have ber 3630 with application softw. RESULTS: Initial calibration Calibration without The reported expanded unco a level of confidence of appur from elements originating for contribution from the device Date of Calibratio	4 hours at 23 °C see actual values in Environ been calibrated in accordance 3:2013 were used to perform in this document are traceable en performed with the assistant are type 7763 (version 8.6 - DE repair/adjustment ertainty is based on the standar roximately 95 %. The uncertain rom the standards, calibration e under calibration. n: 12/09/2023	with the requirements as specific the periodic tests. le to Australian/National standard nce of Brüel & Kjær Sound Level N 3: 8.60) and test procedure 2250- Calibration prior to repair/ X Calibration after repair/ad ard uncertainty multiplied by a co ty evaluation has been carried of method, effect of environmental Certificate issued: 12/0	ds. Meter Calibration Sys 4966. 'adjustment justment verage factor k = 2 p ut in accordance with conditions and any s D9/2023	roviding
Preconditioning: Environment conditions: SPECIFICATIONS: The Sound Level Meter has I Procedures from IEC 61672- The measurements included PROCEDURE: The measurements have been 3630 with application softw. RESULTS: Initial calibration Calibration without The reported expanded unco a level of confidence of appli- trom elements originating fr contribution from the device Date of Calibration Sajeeb Th Calibration Te	4 hours at 23 °C see actual values in Environ been calibrated in accordance 3:2013 were used to perform if in this document are traceable en performed with the assistan- are type 7763 (version 8.6 - DE repair/adjustment ertainty is based on the standar room the standards, calibration e under calibration. n: 12/09/2023 harayil echnician	with the requirements as specific the periodic tests. le to Australian/National standard ince of Brüel & Kjær Sound Level N 3: 8.60) and test procedure 2250- Calibration prior to repair/ X Calibration after repair/ad ard uncertainty multiplied by a co ty evaluation has been carried of method, effect of environmental Certificate issued: 12/0 Carig Patrick	ds. Meter Calibration Sys 4966. Yadjustment justment verage factor k = 2 p ut in accordance with conditions and any s D9/2023	roviding



	Labs	arch Ph: Pty Ltd W		sticiesean	ch.co	m.au	
		Sound C	alibrato)42-2017	or			
	Cal	ibration		ficate			
		on Number C		meate			
	C	30	pectrum Acor Veronica St ardiff NSW 2	treet			
Equip	ment Tested/ Mode Instrument Seria		alsar Model 1 5503	105			
	Barometri	nperature : 23 Humidity : 48	c Conditions 3.8°C 3.3% 00.16kPa	~			
Calibration Tech Calibration		21		dary Check: Issue Date :	Max	doore 2021	
	12.005.0024-000	Signatory :	6 Can	0			Ken Willian
Characteristic Test Generated Sound Pres Frequency Generated Total Distortion		Pass Pass Pass Pass					
	Nominal Level 94	Nominal Fre	quency	Measured Le 94.00	vel		d Frequenc
The sound calibrator has the sound pressu Specific Tests Generated SPL Frequency Distortion	been shown to conform re level(s) and frequency =ft.14dB =ft.09% ±ft.09%	ies) stated, for the er Least Uncertaintie	avironmental cor	nditions under wh nt - nditions udity	ed in Ann iich the ter =0.2°C =2.4% =0.015kP	ex B of IEC its were per	60942-2017 f
	All uncertainties are The tests <1000 kHz are						
			conjunction with	h the calibration b	est report.		
~	This calibration certil Acoustic Research Li	ibs Pty Ltd is NATA	Accredited Lab	oratory Number 1			
NATA	This calibration certii Acoustic Research La Accredited for compl The results of the test units.	iance with ISO/IEC	17025 - calibrati	on.		re traceable	to SI
	Acoustic Research La Accredited for compl The results of the test	iance with ISO/IEC s, calibrations and/or to the ILAC Mutual	17025 - calibration measurements in Recognition Arr	on included in this do angement for the	ocument a		





Appendix III

Operational Details - 16 January 2024 (10:05pm to 12:15am)

Excavator and Truck

EX212 was operating in the CHPP (Zone 7) with 4 x 777 trucks running to the RL120 dump area.

Dozer Push

- •
- 4x DZ's were being used in Zone 1 on waste 1x DZ was being used in Zone 5 on waste 1x DZ was being used at RL120 dump area on carb material push •

Ancillary Equipment

1x Grader being used for haul road maintenance •



